

Date: Wednesday, 10/11/2006 10:29:12 AM
 User: Kim Johnston

Process Sheet

Customer : CU-DAR001 Dart Helicopters Services
 Job Number : 28891
 Estimate Number : 12550
 P.O. Number :
 This Issue : 10/11/2006 S.O. No. :
 Prsht Rev. : NC
 First Issue : // Type : LANDING GEAR
 Previous Run :
 Written By :
 Checked & Approved By : 06 10 11
 Comment : Est Rev:A New Issue 06-10-06 JLM

Drawing Name : FLOAT SKID LH

Part Number : D206642514

Drawing Number : IIN D206-642 REV J Rev L

Project Number : N/A

Drawing Revision : Rev. L

Material :

Due Date : 11/5/2006

Qty:

1 Um:

Each

Additional Product

Job Number:



Seq. #:

Machine Or Operation:

Description :

1.0

DC

DOCUMENT CONTROL



S080629



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-513 CH0001

CH0002 P08.04.26

2.0

28891A

FLOAT SKIDTUBE ASSEMBLY



Comment: Sub-Component FLOAT SKIDTUBE ASSEMBLY

D206-642-545

Batch: 28891A

SP

3.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0

D206648013

GHW Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D206-648-013 GHW Kit

37418

1 D206-642-541(REF)

SP

5.0

D2652

Bushing



Comment: Qty.: 16.0000 Each(s)/Unit Total: 16.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

16 D2652

Bushing

38745

8/5/6

SP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:29:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKID LH

Job Number: 28891

Part Number: D206642514

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

D2712

Set Screw



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

10 D2712

Set Screw

34628

SP

7.0

D29322

206 Saddle Right side



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2932-2

Saddle

37865

SP

8.0

D29332

206 Saddle Right



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2933-2

Saddle

37423

SP

9.0

D2934

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 D2934

Saddle Spacer

37328

SP

10.0

D2935

Saddle Spacer



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 D2935

Saddle Spacer

37867

8/5/6

SP

11.0

D29382

206 Saddle Right side



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2938-2

Saddle

1539131

8/6/13

SP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:29:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dark Helicopters Services

Drawing Name: FLOAT SKID LH

Job Number: 28891

Part Number: D206642514

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

D29392

206 Saddle Right Side



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D2939-2

Saddle

36144

SP

13.0

D3407043

Tow Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3407-043

Tow Ring

57372

SP

14.0

D34561

washer



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 D3456-1

Washer

33275

SP

15.0

AN3C7A

BOLT



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

BOLT

Batch:

105906

SP

16.0

D34571

Inventory



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 D3457-1

Washer

37123

SP

17.0

AN3C35A



Comment: Qty.: 3.0000 Each(s)/Unit Total: 3.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

3 AN3C35A

Bolt

107463

81516

SP

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:29:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKID LH

Job Number: 28891

Part Number: D206642514

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

AN3C36A



Comment: Qty.: 34.0000 Each(s)/Unit Total : 34.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

34 AN3C36A

Bolt

106541

scf

19.0

AN3C41A



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

AN3C41A

Batch:

107463

scf

20.0

AN4C6A

Bolt



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Bolt

106519

scf

21.0

AN5C11A



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

8 AN5C11A

Bolt

107013

(-1)

scf

22.0

AN5C15A

Bolt



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 AN5C15A

Bolt

101291

scf

23.0

AN5C32A



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 AN5C32A

Bolt

105746

8/5/6

scf

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:29:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKID LH

Job Number: 28891

Part Number: D206642514

Job Number:



Seq. #:

Machine Or Operation:

Description :

24.0

AN5C34A



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

2 AN5C34A

Bolt

107289

Scp

25.0

AN5C35A



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

1 AN5C35A

Bolt

107551

Scp

26.0

AN960C10L

washer



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

78 AN960C10L

Washer

107534

Scp

27.0

AN960C416L

WASHER



Comment: Qty.: 24.0000 Each(s)/Unit Total : 24.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

24 AN960C416L

Washer

107008

Scp

28.0

AN960C516L

WASHER



Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

8 AN960C516L

Washer

103544

8/5/10

Scp

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:29:14 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKID LH

Job Number: 28891

Part Number: D206642514

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

MS210433

Nut



Comment: Qty.: 49.0000 Each(s)/Unit Total : 49.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

49 MS21043-3

Nut 107288

Handwritten notes and signatures

50

30.0

MS210434

Nut



Comment: Qty.: 13.0000 Each(s)/Unit Total : 13.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

13 MS21043-4

Nut 107285

30

31.0

MS210435

Nut



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

4 MS21043-5Nut

105430

50

32.0

NAS1515H3L

WASHER



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

78 NAS1515H3L

Washer M106516

Handwritten notes and signatures

33.0

NAS1515H4L

Inventory



Comment: Qty.: 24.0000 Each(s)/Unit Total : 24.0000 Each(s)

Pick:

Qty Part Number

Description

Batch

24 NAS1515H4L

Washer 101542 (8x)

Handwritten notes: M102029 (164), 8/5/5

Handwritten notes: (PK), 56

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
8/9/26	#32	NAS1515H3C has been replaced By D3672-1 Per Rev L. B# <u>B3927549</u> (+78) AS 08/09/26 (+78)				CP 08.09.26 PC AS1042	S 8/9/26	
8/9/26	#33	NAS1515H3C NAS1515H4C Has been replaced By D3672-3 Per Rev L. B# <u>41775</u> (+24) AS 08/09/26 (+24)				CP 08.09.26 PC AS1042	S 8/9/26	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:29:14 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKID LH

Job Number: 28891

Part Number: D206642514

Job Number:



Seq. #:

Machine Or Operation:

Description :

34.0

NAS1515H5L

WASHER



(P10)

Comment: Qty.: 8.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick:

Qty Part Number Description Batch
8 NAS1515H5L Washer 106541

54

35.0

NAS1515H5

Washer



(P10)

Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Pick:

Qty Part Number Description Batch
16 NAS1515H5 Washer M106541 12X

M106541 3X

54

36.0

D33963

Inventory



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Spacer

Batch: 34741

50

37.0

D34521

Bracket



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Bracket

Batch: 28950

54

38.0

D34523

Bracket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Bracket

Batch: B28951

50

39.0

MS21919WDG28

Inventory



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Clamp

Batch: M18847

8/5/5

50

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
8/9/26	#34	NAS 1515 HSL has been replaced by D3672-7 Per Rev L. B# B35522 (FE) AS 08/09/26 (VR)				CP 08.09.26 PL AS/042	8/9/26	
8/9/26	35	NAS 1515 HS has been replaced by D3672-5 Per Rev L. B# B35521 (FE) AS 08/09/26 (VR)				CP 08.09.26 PL AS/042	8/9/26	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:29:14 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKID LH

Job Number: 28891

Part Number: D206642514

Job Number:



Seq. #:

Machine Or Operation:

Description :

40.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



CHECK KIT AGAINST PART LIST
PER IN-D206-642 Rev. L



Comment: INSPECT 100% KITS FOR COMPLETENESS

S 08/09/29 (20)

41.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-511

Location: B

CU 8/9/29 (1)

42.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

D 08/09/29

Job Completion



UNK 08-09-29

28891A

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector




Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

206 A/B FLOAT SKIDTUBES (TRI-BAG FLOATS)
(D206-642-611/-612/-613/-614)

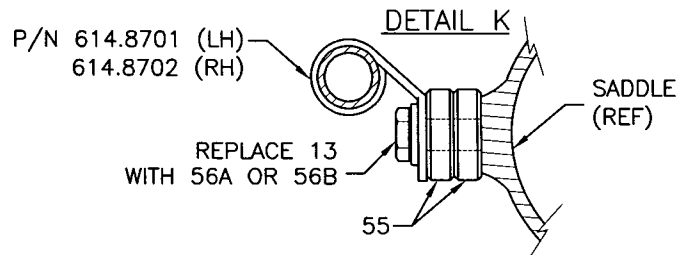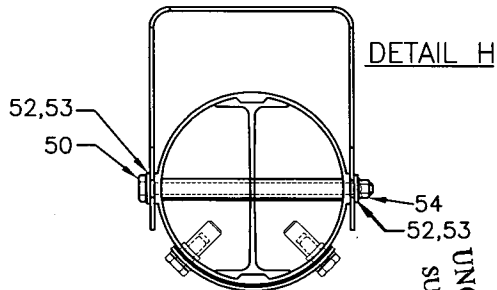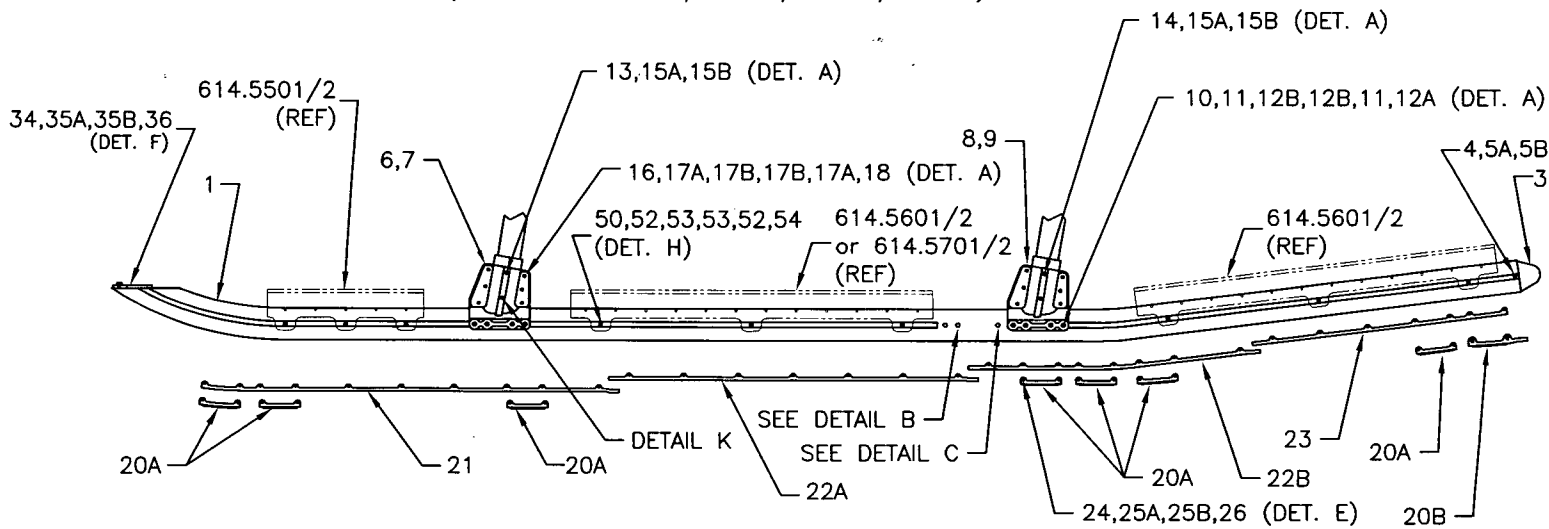


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 28891

• COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. •
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

Revision: J
Date: 05.08.30

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COME
OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC

• COPYRIGHT © 2000 BY DART AEROSPACE USA, INC •

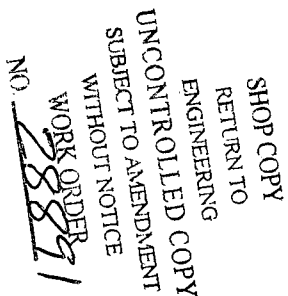

Revision: J
Date: 05.08.30

Date: Wednesday, 10/11/2006 10:29:12 AM
 User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: FLOAT SKID LH
Job Number	: 28891	Part Number	: D206642514
Estimate Number	: 12550	Drawing Number	: IIN D206-642 REV J
P.O. Number	:	Project Number	: N/A
This Issue	: 10/11/2006 S.O. No. :	Drawing Revision	: J
Prsht Rev.	: NC	Material	:
First Issue	: / / Type : LANDING GEAR	Due Date	: 11/5/2006 Qty: 1 Um: Each
Previous Run	:		
Written By	: <u> </u>		
Checked & Approved By	: <u> </u>		
Comment	: Est Rev:A New Issue 06-10-06 JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0 DC

DOCUMENT CONTROL



JL008-5.05



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-513 CHG001

2.0

28891A

FLOAT SKIDTUBE ASSEMBLY



Comment: Sub-Component FLOAT SKIDTUBE ASSEMBLY

D206-642-545

Batch:

3.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0

D206648013

GHW Kit



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D206-648-013 GHW Kit 1 D206-642-541(REF)

5.0

D2652

Bushing



Comment: Qty.: 16.0000 Each(s)/Unit Total : 16.0000 Each(s)

Pick:

Qty Part Number Description Batch

16 D2652 Bushing

4.6 206L/L-1/L-3/L-4/407 High Gear Float Skidtubes (OEM/PMA BAG COMPATIBLE)

Item	Qty -513	Qty -514	Qty -545	Qty -547	Qty -013	Part Number	Description
	X					D206-642-513	SKIDTUBE INSTALLATION, LH
		X				D206-642-514	SKIDTUBE INSTALLATION, RH
	1	1	X			D206-642-545	SKIDTUBE ✓
				X		D206-642-547	WEARSHOE KIT (REPLACES -543 KIT)
	1	1			X	D206-648-013	GROUND HANDLING KIT ✓
1			1			D3274-043	SKIDTUBE ASSEMBLY
3			1			D2646	* AFT CAP ⁽¹⁾
4			2			AN3C4A	* BOLT ⁽¹⁾
5A			2			AN960C10L	* WASHER ⁽¹⁾
5B			2			D3672-1	* WASHER (REPLACES NAS1515H3L) ⁽¹⁾
6	1					D2932-1	SADDLE, FWD OUT, LH
6		1				D2932-2	SADDLE, FWD OUT, RH ✓
7	1					D2933-1	SADDLE, FWD IN, LH
7		1				D2933-2	SADDLE, FWD IN, RH ✓
8	1					D2938-1	SADDLE, AFT OUT, LH
8		1				D2938-2	SADDLE, AFT OUT, RH ✓
9	1					D2939-1	SADDLE, AFT IN, LH
9		1				D2939-2	SADDLE, AFT IN, RH ✓
10	8	8				AN3C41A	BOLT
11	16	16				D2652	BUSHING ✓
12A	8	8				MS21043-3	NUT ✓
12B	16	16				D3672-5	WASHER (REPLACES NAS1515H5) ?
13	4	4				AN5C11A (or AN5C12A)	* BOLT ⁽²⁾ ✓
14	4	4				AN5C11A (or AN5C12A)	* BOLT ⁽²⁾ ✓
15A	8	8				AN960C516L	WASHER ✓
15B	8	8				D3672-7	WASHER (REPLACES NAS1515H5L) ?
16	12	12				AN4C6A	BOLT ✓
17A	24	24				D3672-3	WASHER (REPLACES NAS1515H4L) ?
17B	24	24				AN960C416L	WASHER ✓
18	12	12				MS21043-4	NUT ✓
20A			9	9		D3537-1	* WEARPAD ⁽¹⁾ (REPLACES D2648-3)
21A			1	1		D3537-3	* WEARPAD ⁽¹⁾ (REPLACES D3429-1)
22A			1	1		D3535-15	* WEARSHOE ⁽¹⁾ (REPLACES D2656-15)
22B			1	1		D3536-15	* GASKET ⁽¹⁾
23A			1	1		D3535-23	* WEARSHOE ⁽¹⁾ (REPLACES D2656-23)
23B			1	1		D3536-23	* GASKET ⁽¹⁾
24A			1	1		D3535-39	* WEARSHOE ⁽¹⁾ (REPLACES D3287-1)
24B			1	1		D3536-39	* GASKET ⁽¹⁾
25A			1	1		D3535-35	* WEARSHOE ⁽¹⁾ (REPLACES D2656-35)
25B			1	1		D3536-35	* GASKET ⁽¹⁾
26A			78	78		AN3C4A	* BOLT ⁽¹⁾
26B			78	78		AN960C10L	* WASHER ⁽¹⁾
26C			78			ALS7-1032-130	* INSERT ⁽¹⁾ (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
30	1	1				D3407-043	TOW RING ✓
32A	1	1				D3456-1	WASHER ✓
32B	2	2				D3457-1	WASHER ✓
33	1	1				MS21043-4	NUT ✓
34			1			AN4C5A	BOLT
35			1			AN960C416	WASHER
36			1			D3413-1	RING
37	10	10				D2712	SET SCREW ✓
38	2	2				D2934	SADDLE SPACER ✓
39	2	2				D2935	SADDLE SPACER ✓

continued on next page...

• COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. •

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

Revision: L

Date: 07.10.25

continued from previous page...

Item	Qty -513	Qty -514	Qty -545	Qty -547	Qty -013	Part Number	Description
40					2	D3414-041	LUG ASSEMBLY (GHW)
41					4	AN3C37A	BOLT
42					8	D2652	BUSHING
43					4	MS21043-3	NUT
44					4	AN960C10	WASHER
50	34	34				AN3C36A	BOLT
51	3	3				AN3C35A	BOLT
52	74	74				AN960C10L	WASHER
53	74	74				D3672-1	WASHER (REPLACES NAS1515H3L)
54	37	37				MS21043-3	NUT
55	2	2				D3396-3	SPACER
56A	1	1				AN5C35A	BOLT
56B	1	1				AN5C15A	BOLT
60	2	2				AN5C32A	BOLT
61	2	2				AN5C34A	BOLT
62	4	4				MS21043-5	NUT
70	2	2				D3452-1	BRACKET
71	1	1				D3452-3	BRACKET
72	4	4				MS21919WDG-28	CLAMP
73	4	4				AN3C7A	BOLT
74	4	4				AN960C10L	WASHER
75	4	4				D3672-1	WASHER (REPLACES NAS1515H3L)
76	4	4				MS21043-3	NUT

NOTES: (1) DENOTES THAT PART IS INCLUDED WITH D3274-043 ASSEMBLY ABOVE
 (2) CHOICE OF BOLT WILL DEPEND ON CROSSTUBE (SEE INSTALLATION PROCEDURE)

• COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. •

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

Revision: L
 Date: 07.10.25

THE
JOURNAL
OF
THE
ROYAL
ANTHROPOLOGICAL
INSTITUTE
OF GREAT
BRITAIN
AND IRELAND
VOLUME
LXXV
PART I
1945

Date: Wednesday, 10/11/2006 10:30:12 AM
 User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: FLOAT SKIDTUBE ASSEMBLY
Job Number	: 28891A		
Estimate Number	: 12548		
P.O. Number	:	Part Number	: D206642545
This Issue	: 10/11/2006 S.O. No. :	Drawing Number	: D3274 REV C <i>Rev D</i>
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: 1/1 Type : LANDING GEAR	Drawing Revision	: <i>CD</i>
Previous Run	: 28890A	Material	:
Written By	:	Due Date	: 11/5/2006 Qty: 1 Um: Each
Checked & Approved By	: <i>061011</i>		
Comment	: Est Rev: A New Issue 06-10-06 JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-545 CHG001

CHG 002 06-05-26

2.0

D26001240

Extrusion Round 3" 206



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2600-1-240 3" OD Tube *B31032**DP**7-11-19*

3.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Cut D2600-1 to 190.00" in length as per Dwg D3274 and Deburr ends

2-Drill #40 Aft cap pilot hole using DT8025

3-Cleco DT8025 in position and install pilot hole drill Jig DT8891 A,BC & D Drill 3/16" & 1/8" pilot holes as per Dwg D3274

4-Remove inner indexing ridge on aft end of skidtube as per Dwg D3274

5-Open aft end cap holes to Ø0.208" as per Dwg D3274. Deburr aft end.

DP
7-11-19

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:30:12 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description :

4.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid Etch and Alodine tube as per QSI 005 4.1

DP 2-11-19

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

RE 08-04-07

6.0

D3282041

I-Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3282-041 Float Web

37052

SL 8-4-7

7.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open 1/8" PILOTS TO Ø0.313" crossbolt spacer holes as per Dwg D3274

2-Open 3/16" Pilots to Ø0.375" crossbolt spacer holes as per Dwg D3274

3-Deburr crossbolt spacer holes as per Dwg D3274 and blow out chips from inside the tube

4-Bond web in place as per Dwg D3274 & QSI 015.

A/R Sikaflex-291

Sikaflex expire date:

Start:

Finish:

(Adhere for 12 hours)

107397

8-7-31

8-4-7

Time: 1:15

Time: 9:45AM

SL 8-4-7

8.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

8 08/04/08 (EO)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:30:12 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description:

9.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Bend tube using program D3274 as per Dwg D3274. Install drop pins in cross bolt spacer holes to maintain web position.

2-Cut Fwd end of tube to length as per Dwg D3274

3-Remove inner indexing ridge on Fwd end of skidtube as per Dwg D3274

4- DRILL PILOT HOLES FOR WEARPLATES USING D3274-1T2
OPEN HOLES TO .1875

5- C'SINK WITH 3/16 C'SINK BIT (ENSURE NOT TO C'SINK TO DEEP)

6- OPEN HOLES TO .257 AS PER DRWG D3274

7- FINISH C'SINK WITH .257 C'SINK BIT (ENSURE NOT TO C'SINK PAST THE BOTTOM, ONLY CUT THE TOP) AND INSPECT C'SINK WITH A SAMPLE NAS1330C3KB116 INSERT TO ENSURE INSERTS WILL SIT FLUSH, AND HOLE IS NOT OVERSIZED

8- DEBURR INSIDE OF HOLE AS NECESSARY (DO NOT ENLARGE HOLES)
REMOVE ANY FOREIGN OBJECTS INSIDE OF TUBES

9- Countersink crossbolt spacer holes as per Dwg D3274

EL/JR
8-4-9

8-4-11

10.0

D32851

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3285-1

Fwd Cap

B33702

BE 08/04/21

11.0

D2649

Crossbolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Pick:

Qty Part Number Description Batch

12 D2649

Crossbolt spacer

B37329

BE 08/04/21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:30:12 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description :

12.0

D32751

Crossbolt Spacer



Comment: Qty.: 37.0000 Each(s)/Unit Total: 37.0000 Each(s)

Pick:

Qty Part Number Description Batch

37 D3275-1 Crossbolt spacer

B35210 BE 08/04/21

13.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Weld Fwd Cap as per Dwg D3274 and QSI 004. Use aluminum rod.

A/R Aluminum Rod

m106330/m107263

BE 08/04/21

2-Insert D2649 & D3275-1 crossbolt spacers. Weld as per QSI 004 and Dwg D3274. Remember to back drill each hole before welding the other side. Use aluminum rod

A/R Aluminum Rod

m106330

BE 08/04/21

3-Grind welds flush to Fwd cap on top surface only.

4-Grind cross bolt welds flush as per Dwg D3274. Masking Tape access to inside of the skidtube

5-Counterbore 5/16" x 0.750" deep as per Dwg D3274. Use DT8743 visual aid Jig and deburr.

g422

14.0

QC5/10

WELD INSPECTION



Comment: Inspect weld and Counterbore. Inspect for foreign objects as per QSI 024

15.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

M107550

HI 08-01-C

16.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

17.0

D3415041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3415-041 Nut Plate

B28891A
D20664254
24/04/2008
S.111
#1 321.5
#2
#3
#4
WAVE

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:30:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description :

18.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 CCR264SS3-3 Rivet

19.0

CR3212403

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 CR3212-4-03 Rivet

20.0

D26483

Wearpad



Comment: Qty.: 9.0000 Each(s)/Unit Total : 9.0000 Each(s)

Pick:

Qty Part Number Description Batch
9 D2648-3 Wearpad

21.0

D265615

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 D2656-15 Wearshoe

22.0

D265623

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 D2656-23 Wearshoe

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:30:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

D265635

Wearplate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2656-35 Wearshoe

24.0

D32871

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3287-1 Wearshoe

25.0

D34291



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3429-1 Wearpad

*See D
see attached*

26.0

AN960C10L

washer



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Pick:

Qty Part Number Description Batch

78 AN960C10L Washer

W

27.0

MS27039C108

SCREW



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Pick:

Qty Part Number Description Batch

78 MS27039C1-08Screw

28.0

NAS1330C3KB116

Insert



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Pick:

Qty Part Number Description Batch

78 NAS1330C3KB116 Inserts

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:30:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

NAS1515H3L

WASHER



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Pick:

Qty Part Number Description Batch

78 NAS1515H3L Washer _____

30.0

D34131

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3413-1 Ring _____

31.0

AN4C5A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN4C5A Bolt _____

32.0

AN960C416L

WASHER



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN960C416L Washer _____

33.0

NAS1515H4L

Inventory



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 NAS1515H4L Washer _____

34.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646 Aft Cap _____

REV D
see 2H schedule

W

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:30:13 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

35.0	AN960C10L	washer
------	-----------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 AN960C10L Washer

36.0	MS27039C108	SCREW
------	-------------	-------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 MS27039C1-08Screw

37.0	NAS1515H3L	WASHER
------	------------	--------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 NAS1515H3L Washer

Rev. D
all attached
u

38.0	HAND FINISHING1	HAND FINISHING RESOURCE #1
------	-----------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

1-Install Nut Plate as per Dwg D3274. Apply LPS-3 to Nut Plate and rivets.

A/RN/ALPS-3

2-Install inserts & wearpads as per Dwg D3274. Use a drop of Sikaflex inside insert holes and a layer of sikaflex between wearplates and skidtube.

A/R Sikaflex-291

Sikaflex expire date:

3-Install ring as per Dwg D3274

A/R Sikaflex-291

Sikaflex expire date:

4-Inspect for foreign objects as per QSI 024

5-Spray inside of tube on both sides of web with LPS-3

A/R LPS-3 Batch:

6-Install Aft Cap and seal with Sikaflex. Clean excess adhesive.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Wednesday, 10/11/2006 10:30:14 AM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description :

A/R Sikaflex-291 _____
Sikaflex expire date: _____

39.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

40.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN CP	DRAWN BY CP	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D3274	REV. C SHEET 1 OF 4
DATE 05.03.16		TITLE SKIDTUBE ASSEMBLY	SCALE NTS
A	04.03.15	NEW ISSUE	
B	04.08.09	MOVE SADDLE HOLE: 42.14 WAS 42.76	
C	05.03.16	ADD -043; NEW INSERTS	

RELEASED
05-09-06 *[Signature]*

Qty -041	Qty -043	Part Number	Description
X		D3274-041	SKIDTUBE ASSEMBLY
	X	D3274-043	SKIDTUBE ASSEMBLY
1	1	D2600-1-240	EXTRUSION
9	9	D2648-3	WEARPAD
12	12	D2649	CROSS BOLT SPACER
1	1	D2656-15	WEARSHOE
1	1	D2656-23	WEARSHOE
1	1	D2656-35	WEARSHOE
12	37	D3275-1	CROSS BOLT SPACER
1	1	D3282-041	FLOAT WEB
1	1	D3285-1	CAP
1	1	D3287-1	WEARSHOE
1	1	D2646	AFT CAP
1	1	D3413-1	RING
1	1	D3415-041	NUT PLATE
1	1	D3429-1	WEARPAD
78	78	NAS1330C3KB116	INSERT
80	80	NAS1515H3L	WASHER
1	1	NAS1515H4	WASHER
2	2	CCR264SS3-3	RIVET
2	2	CR3212-4-03	RIVET
80	80	MS27039C1-08	SCREW
1	1	AN4C5A	BOLT

GENERAL NOTES:


1. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
2. DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 7 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
3. ALL HOLES DRILLED ON CENTERLINES.
4. BOND D3282-041 FLOAT WEB INTO D3274-1/-3 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
5. WELDING TO BE DONE PER DART QSI 004.
6. FINISH: - ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1
- POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
7. DRILL 'E' (Ø0.250 REF) AND C'SINK Ø0.391x100° FOR NAS1330C3KB116 INSERT USING DT3274-1T2 BEFORE FINISH. INSTALL NAS1330C3KB116 INSERTS AFTER FINISH WITH LPS LABORATORIES "LPS-3".
8. WEARPLATES TO BE INSTALLED WITH A LAYER OF SIKAFLEX-241/-291 ADHESIVE BETWEEN WEARPLATES AND SKIDTUBE.
9. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DESGREASER.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. **2889** 1A


Copyright © 2004 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

DETAIL A: DRILL DETAIL

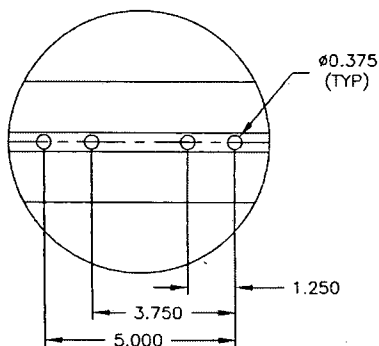


DETAIL B FOR 0.375 HOLES ONLY

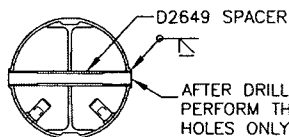

- AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR 0.375
HOLES ONLY:
1. CHAMFER HOLE 0.030x45°
 2. INSERT D2649 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE TO 0.313x0.75 DEEP


DETAIL C FOR 0.313 HOLES ONLY

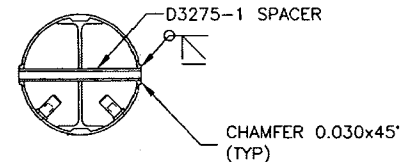


DETAIL D



DETAIL E

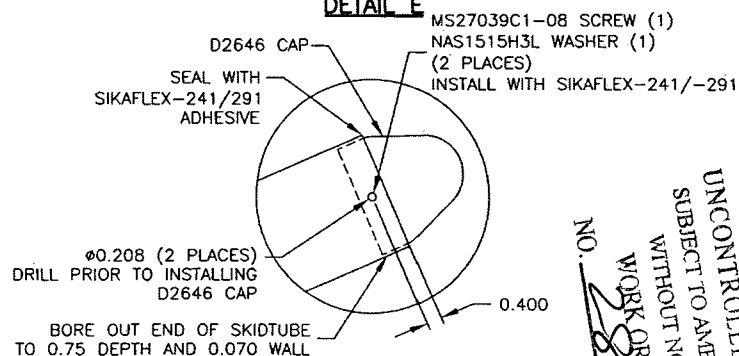

DETAIL F: END FINISHING DETAIL

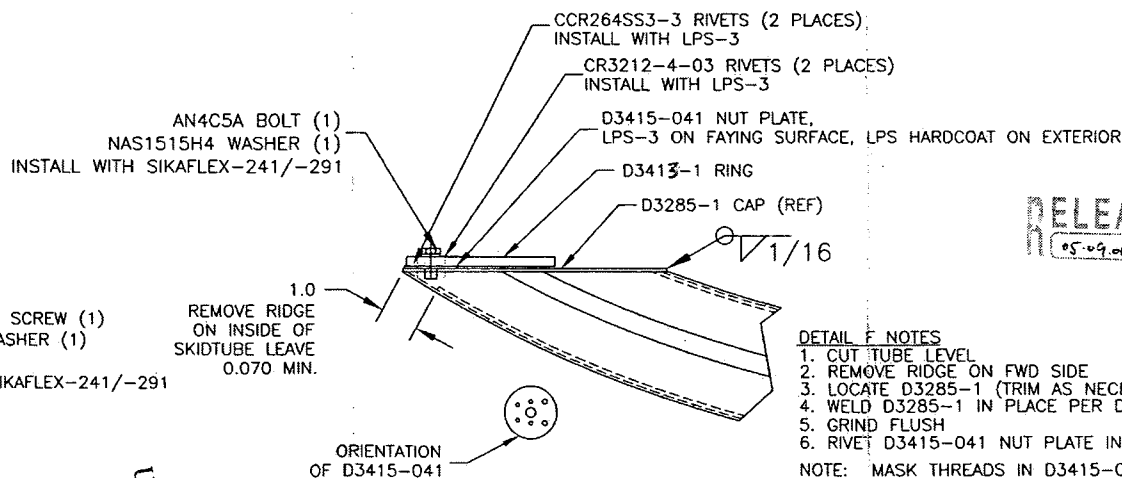


- DETAIL F NOTES**
1. CUT TUBE LEVEL
 2. REMOVE RIDGE ON FWD SIDE
 3. LOCATE D3285-1 (TRIM AS NECESSARY)
 4. WELD D3285-1 IN PLACE PER DART QSI 004
 5. GRIND FLUSH
 6. RIVET D3415-041 NUT PLATE IN PLACE
- NOTE: MASK THREADS IN D3415-041 PRIOR TO FINISH

RELEASED
05-09-06


NO. 28831
WORK ORDER
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA
CHECKED	DATE	CP	CP	
05.03.16				DRAWING NO. D3274
				REV. C SHEET 2 OF 4
				TITLE SKIDTUBE ASSEMBLY
				SCALE 1 TO 3

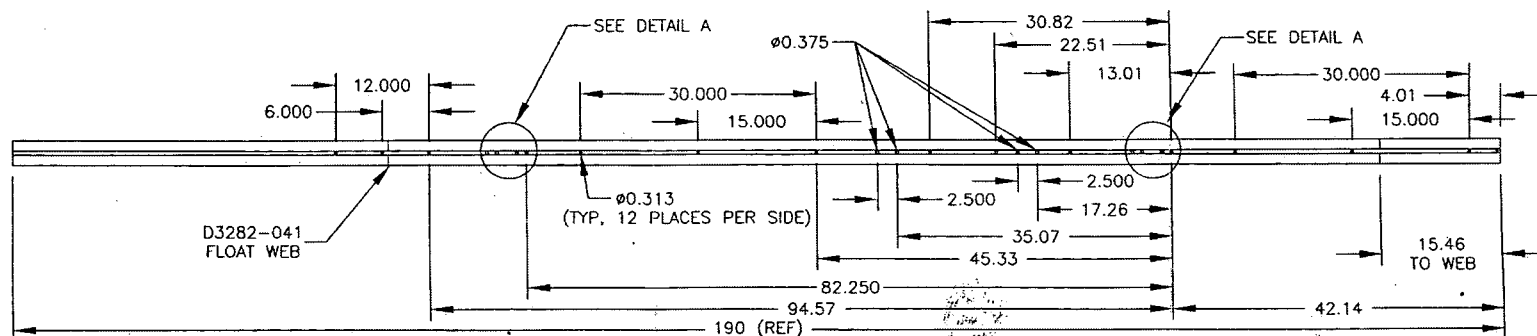


D3274-041 DRILLING/ASSEMBLY DETAIL

RELEASED
05-09-06

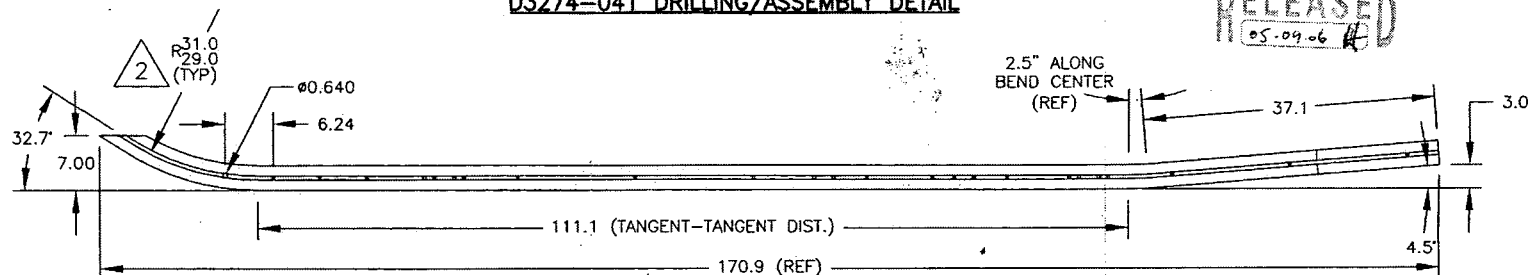

D3274-041 BEND/DRILLING DETAIL

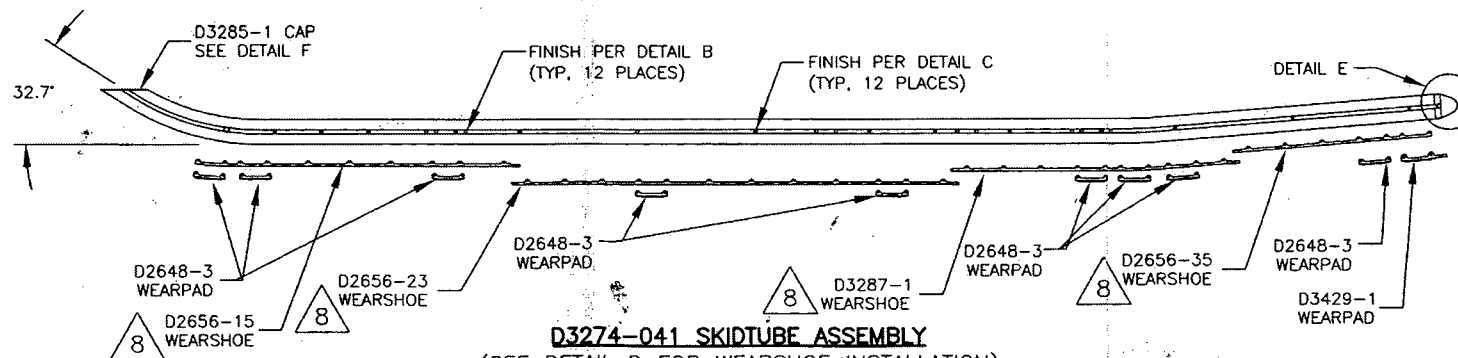


D3274-041 SKIDTUBE ASSEMBLY
(SEE DETAIL D FOR WEARSHOE INSTALLATION)


NO. 28871 A
WORK ORDER
SUBJECT TO AMENDMENT,
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN	DRAWN BY	DART AEROSPACE USA, INC. PORT HADLOCK, OH	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CP	CP	DRAWING NO. D3274	REV. C
DATE 05.03.16		CHECKED #	APPROVED #	TITLE SKIDTUBE ASSEMBLY	SHEET 3 OF 4 1:15


1709
 111.1
 59.8
 37.1
 22.7

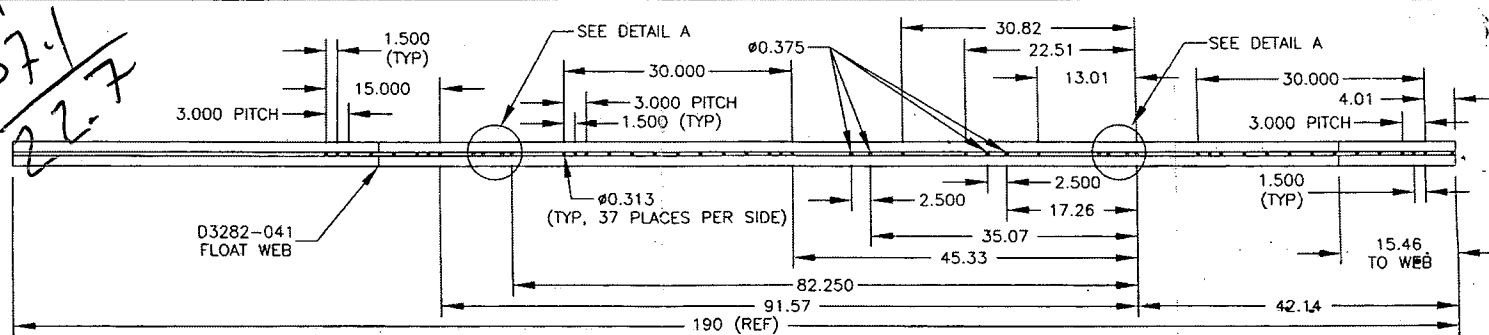

D3274-043 DRILLING/ASSEMBLY DETAIL

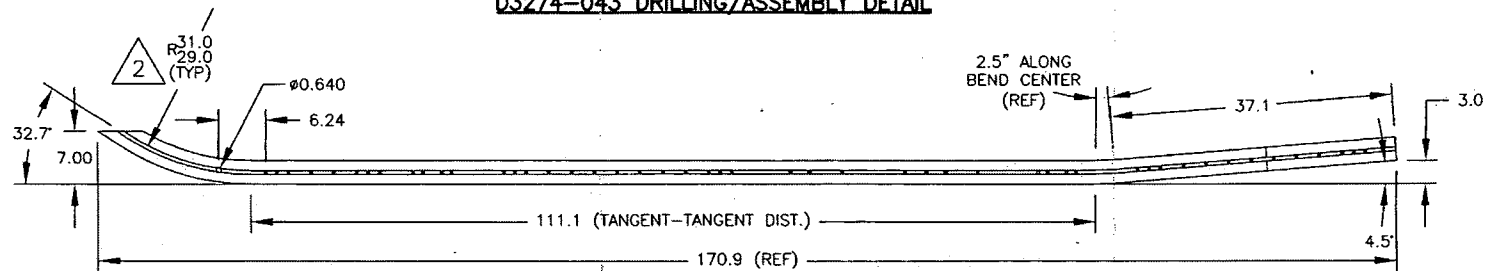

D3274-043 BEND/DRILLING DETAIL

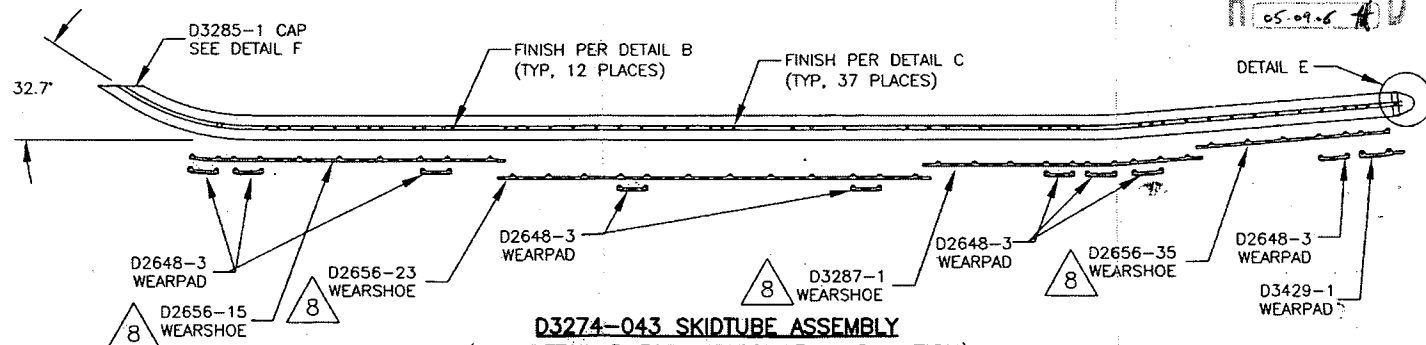

D3274-043 SKIDTUBE ASSEMBLY
 (SEE DETAIL D FOR WEARSHOE INSTALLATION)

RELEASED
 05-09-06

SHOP COPY
 RETURN TO
 ENGINEERING
 UNCONTROLLED COPY
 SUBJECT TO AMENDMENT
 WITHOUT NOTICE
 WORK ORDER
 NO. 28821A

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.		DESIGN CP	DRAWN BY CP	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.		CHECKED #	APPROVED #	
		DATE 05.03.16	TITLE SKIDTUBE ASSEMBLY	
				REV. C SHEET 4 OF 4 SCALE 1:15

NO. 146

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliot
Job number: 37704A
Part number: D058 612 041
Description: oil-se skid tube
Welding Process: Tig ☒ Mig ☐
Base material: Aluminium
Current: AC ☒ DC ☐

TEST REQUIREMENTS AND RESULTS

Visual: pass ☒ fail ☐
Penetration: pass ☒ fail ☐

UNACCEPTABLE

Cracks: pass ☒ fail ☐
Undercut: pass ☒ fail ☐
Pin holes: pass ☒ fail ☐
Overlap (cold lap): pass ☒ fail ☐
Porosity (surface): pass ☒ fail ☐
Coloration: pass ☒ fail ☐

Qualifier Pat. Dupel Date of Test Coupon 08-03-28

Welder Barclay Elliot Date of Test Coupon 08-03-28

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date: Friday, 25/04/2008 10:59:49 AM
 User: Linda Lacelle

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	FLOAT SKIDTUBE ASSEMBLY
Job Number :	28891A		
Estimate Number :	12548		
P.O. Number :		Part Number :	D206642545
This Issue :	25/04/2008	Drawing Number :	D3274 REV C Rev D <i>CP 02-05-24</i>
Prsht Rev. :	NC	Project Number :	N/A
First Issue :	11/10/2006	Drawing Revision :	<i>SD</i>
Previous Run :	28890A	Material :	
Written By :	<i>[Signature]</i>	Due Date :	05/11/2006
Checked & Approved By :	<i>[Signature]</i>	Qty:	1
Comment :	Est Rev:A New Issue 06-10-06 JLM	Um:	Each

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
16.0	QC3	INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FD 08/05/02 (1)

17.0	D3415041	Nut Plate
------	----------	-----------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
1	D3415-041	Nut Plate	<i>B33842</i>

FD.

18.0	CCR264SS33	Cherry Rivet
------	------------	--------------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
2	CCR264SS3-3	Rivet	<i>m106825</i>

FD.

19.0	CR3212403	Cherry Rivet
------	-----------	--------------



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty	Part Number	Description	Batch
2	CR3212-4-03	Rivet	<i>m15918</i>

FD. 08/05/02 (1)

Date: Friday, 25/04/2008 10:59:49 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

ALS71032130

Insert



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Insert

Batch: m105819

Fl.

21.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Install Nut Plate as per Dwg D3274. Apply LPS-3 to Nut Plate and rivets.

A/RN/ALPS-3 m105005

2-Install inserts as per Dwg D3274. Use a drop of Sikaflex inside insert holes a

A/R Sikaflex-291 m107804

Sikaflex expire date: 08/10

08/05/02 (P)

22.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Nut Plate & Inserts

1 (A) 08/05/02 (P)

23.0

AN3C4A

BOLT



Comment: Qty.: 80.0000 Each(s)/Unit Total : 80.0000 Each(s)

BOLT

Batch: m107715 (x59)

m107242 (x21) Fl.

24.0

D353515

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B37810

Fl.

25.0

D353523

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B35218

Fl. 08/05/05 (P)

Date: Friday, 25/04/2008 10:59:49 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description :

26.0

D353535

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B38760

FD.

27.0

D353539

Wearshoe



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B37277

FD.

28.0

D353615

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B33964

FD.

29.0

D353623

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B33965

FD.

30.0

D353635

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B37352

FD.

31.0

D353639

Gasket



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B33966

FD.

32.0

D35371

Wearpad



Comment: Qty.: 9.0000 Each(s)/Unit Total : 9.0000 Each(s)

WEARPAD

Batch: B36426

FD 08/05/05 ①

Date: Friday, 25/04/2008 10:59:49 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description :

33.0

D35373

Wearpad



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
WEARPAD

1533881

FL

34.0

AN960C10L

washer



Comment: Qty.: 80.0000 Each(s)/Unit Total: 80.0000 Each(s)
Pick:

Qty Part Number Description Batch
80 AN960C10L Washer

m107137

FL

35.0

D36721

Phenolic Washer



Comment: Qty.: 2.0000 Each(s)/Unit Total: 2.0000 Each(s)
Washer
batch

634470

FL

36.0

D34131

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Pick:

Qty Part Number Description Batch
1 D3413-1 Ring

1533949

FL

37.0

AN4C5A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Pick:

Qty Part Number Description Batch
1 AN4C5A Bolt

m104936

FL

38.0

AN960C416L

WASHER



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)
Pick:

Qty Part Number Description Batch
1 AN960C416 Washer

m107008

FL 08/05/05 (1)

Date: Friday, 25/04/2008 10:59:49 AM
User: Linda Lacelle

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 28891A

Part Number: D206642545

Job Number:



Seq. #:

Machine Or Operation:

Description :

39.0

D2646

Aft Cap



PLD →

Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part Number

Description Batch

1 D2646

Aft Cap

037755

FL

40.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

2-Install wearpads & gaskets as per Dwg D3274.

3-Install ring as per Dwg D3274

A/R Sikaflex-291

m107804

Sikaflex expire date:

08/10

4-Inspect for foreign objects as per QSI 024

5-Spray inside of tube on both sides of web with LPS-3

A/R LPS-3

Batch: m105005

6-Install Aft Cap and seal with Sikaflex. Clean excess adhesive.

A/R Sikaflex-291

m107804

Sikaflex expire date:

08/10

FL 08/05/05 ①

41.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/05/05 ②

42.0

QC21

FINAL INSPECTION/W/O RELEASE

 



Comment: FINAL INSPECTION/W/O RELEASE


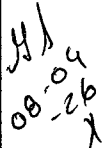



Job Completion



MF 08-09-29

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	
08.09.26	1	COPY BLUEPRINT & LABELS FOR <u>CHG002</u> TUBE ACCEPTABLE TO D3274 Rev.D				 08.09.26 PC Q31042	 08/09/26	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☒ No ☐ DQA: D Date: 08/09/26
QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			
		Demarcus removed Aft cap was damaged R.C. 2. head fix was too old and to hard	 08/09/26	Scrap and destroy and replace Bk <u>41435</u>	 08-09-26 X1	 08/09/26	 08/09/26	 08/09/26

NOTE: Date & initial all entries



DESIGN CP	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. D3274	REV. D SHEET 1 OF 4
DATE 06.12.19		TITLE SKIDTUBE ASSEMBLY	SCALE NTS
A	04.03.15	NEW ISSUE	
B	04.08.09	MOVE SADDLE HOLE: 42.14 WAS 42.76	
C	05.03.16	ADD -043; NEW INSERTS	
D	06.12.19	NEW INSERTS, SS WEARSHOE + GASKET	

RELEASED

07.02.12 **[Signature]**

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 28851A


Qty -041	Qty -043	Part Number	Description
X		D3274-041	SKIDTUBE ASSEMBLY
	X	D3274-043	SKIDTUBE ASSEMBLY
1	1	D2600-1-240	EXTRUSION
1	1	D2646	AFT CAP
12	12	D2649	CROSS BOLT SPACER
12	37	D3275-1	CROSS BOLT SPACER
1	1	D3282-041	FLOAT WEB
1	1	D3285-1	CAP
1	1	D3413-1	RING
1	1	D3415-041	NUT PLATE
1	1	D3535-15	WEARSHOE
1	1	D3535-23	WEARSHOE
1	1	D3535-35	WEARSHOE
1	1	D3535-39	WEARSHOE
1	1	D3536-15	GASKET
1	1	D3536-23	GASKET
1	1	D3536-35	GASKET
1	1	D3536-39	GASKET
9	9	D3537-1	WEARPAD
1	1	D3537-3	WEARPAD
78	78	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
80	80	AN3C4A	BOLT
1	1	AN4C5A	BOLT
1	1	AN960C416	WASHER
80	80	AN960C10L	WASHER
2	2	CCR264SS3-3	RIVET
2	2	CR3212-4-03	RIVET
2	2	NAS1515H3L	WASHER

GENERAL NOTES:


1. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
2. DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 7 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
3. ALL HOLES DRILLED ON CENTERLINES.
4. BOND D3282-041 FLOAT WEB INTO D3274-1/-3 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291 ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
5. WELDING TO BE DONE PER DART QSI 004.
6. FINISH: - ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1
- POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
7. DRILL Ø0.297 HOLES FOR ALS7-1032-130 INSERTS USING DT3274-1T2 BEFORE FINISH. INSTALL ALS7-1032-130 INSERTS AFTER FINISH. SEAL WEARSHOE BOLTS WITH SIKAFLEX -241/-291.
8. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.

Copyright © 2004 by DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

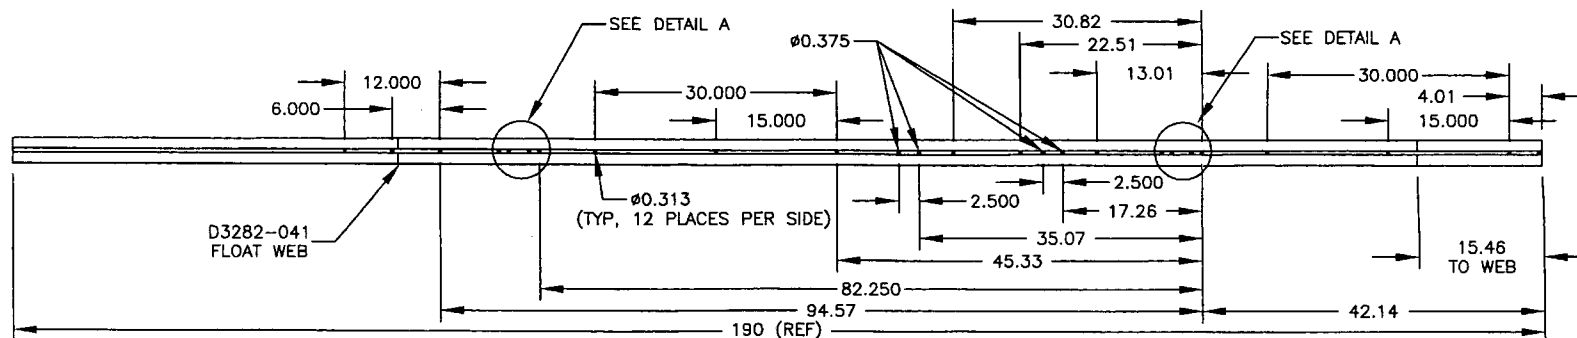

D3274-041 DRILLING/ASSEMBLY DETAIL

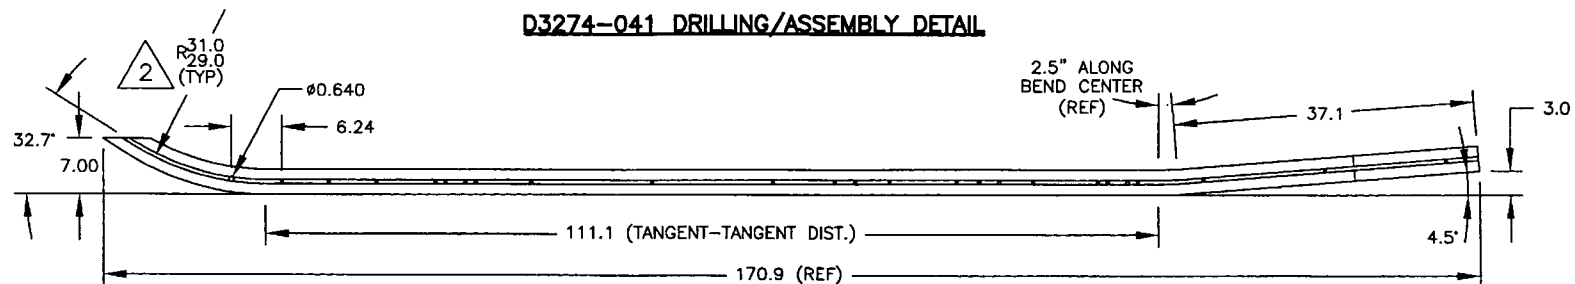

D3274-041 BEND/DRILLING DETAIL

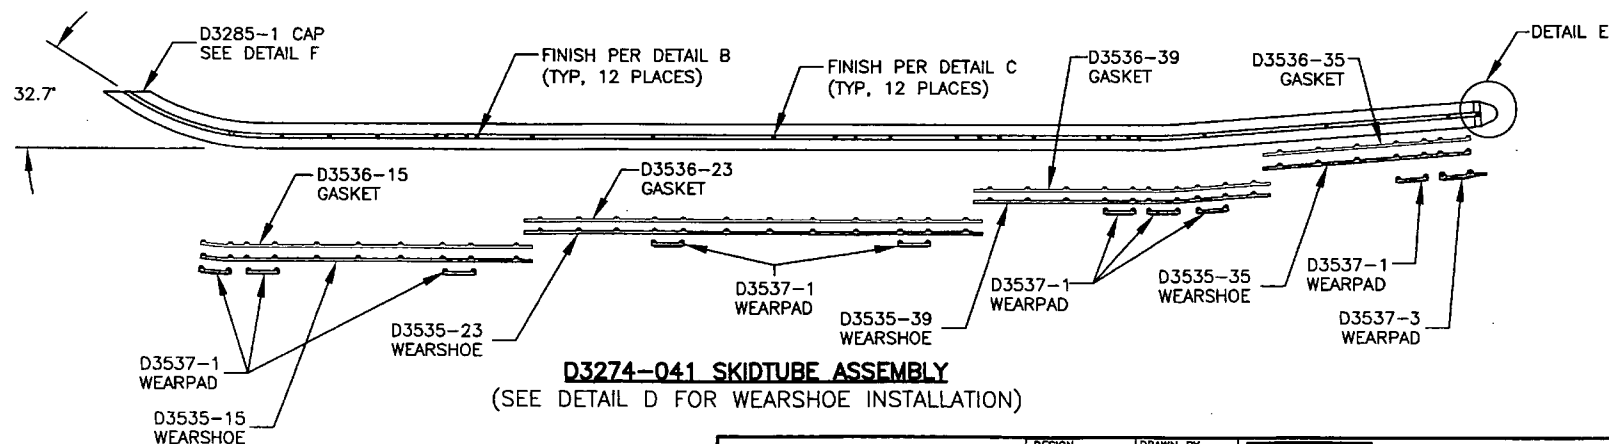

D3274-041 SKIDTUBE ASSEMBLY
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 78611A


RELEASED

07.02.12


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.


DESIGN	CP	DRAWN BY	PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	REV. D
CHECKED	#	APPROVED	#	DRAWING NO. D3274	SHEET 2 OF 4
DATE	06.12.19	TITLE	SKIDTUBE ASSEMBLY	SCALE	1:15

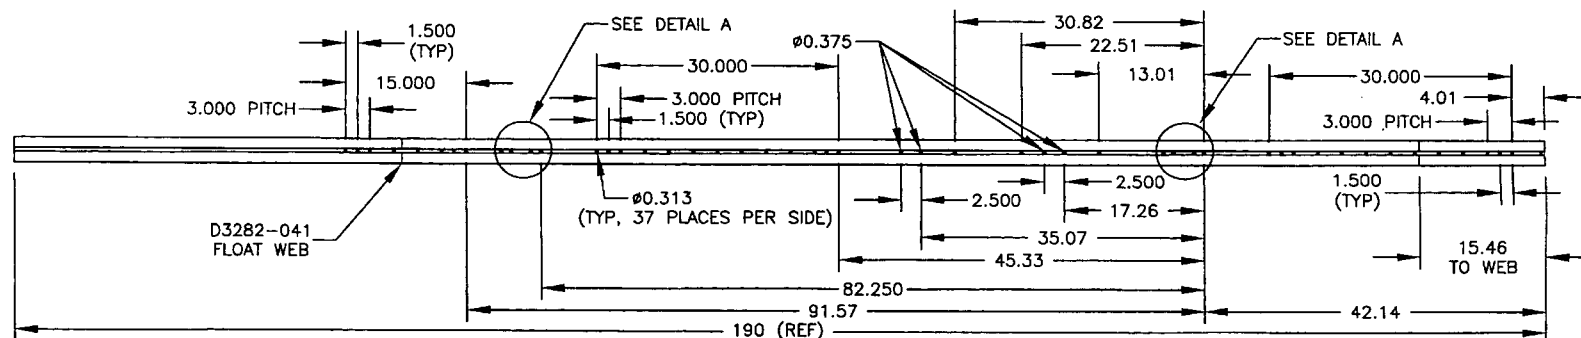

D3274-043 DRILLING/ASSEMBLY DETAIL

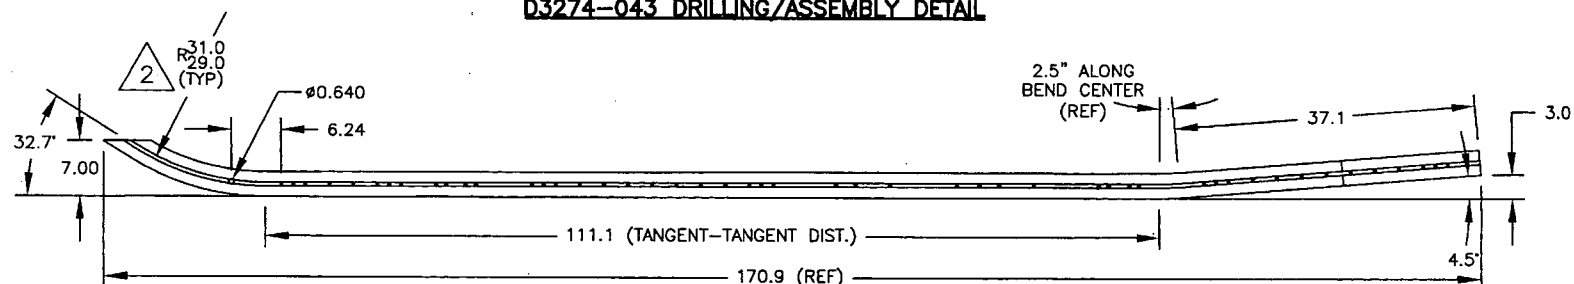

D3274-043 BEND/DRILLING DETAIL

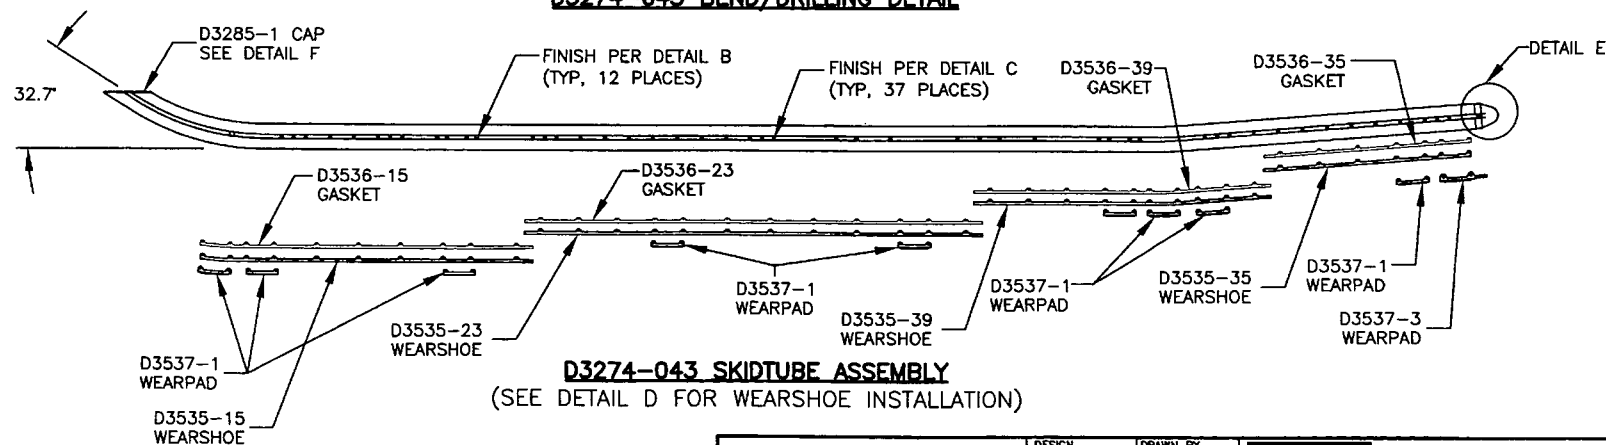

D3274-043 SKIDTUBE ASSEMBLY
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 72851A

RELEASED


07.02.12

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.

DESIGN CP	DRAWN BY PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA	
CHECKED H	APPROVED H	DRAWING NO. D3274	REV. 0 SHEET 3 OF 4
DATE 06.12.19	TITLE SKIDTUBE ASSEMBLY		SCALE 1:15

DETAIL A: DRILL DETAIL

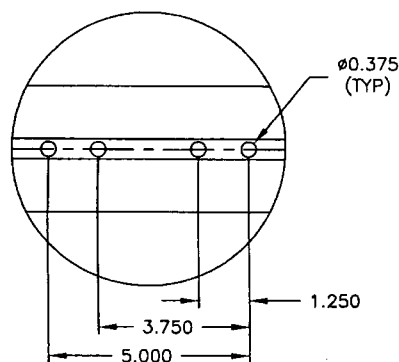


DETAIL B FOR 0.375 HOLES ONLY

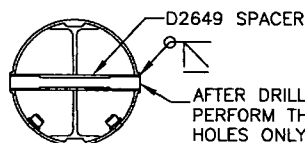


- AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR 0.375
HOLES ONLY:
1. CHAMFER HOLE 0.030x45°
 2. INSERT D2649 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE TO 0.313x0.75 DEEP

DETAIL C FOR 0.313 HOLES ONLY

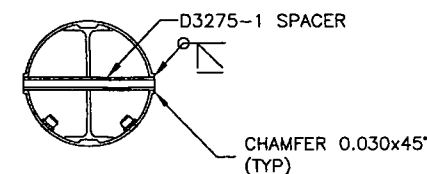


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 78651A

DETAIL D

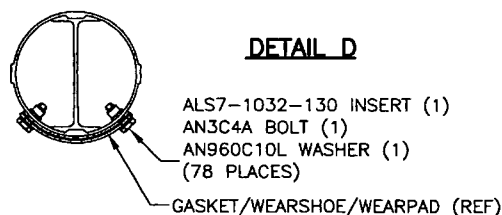


- ALS7-1032-130 INSERT (1)
AN3C4A BOLT (1)
AN960C10L WASHER (1)
(78 PLACES)
GASKET/WEARSHOE/WEARPAD (REF)

DETAIL E

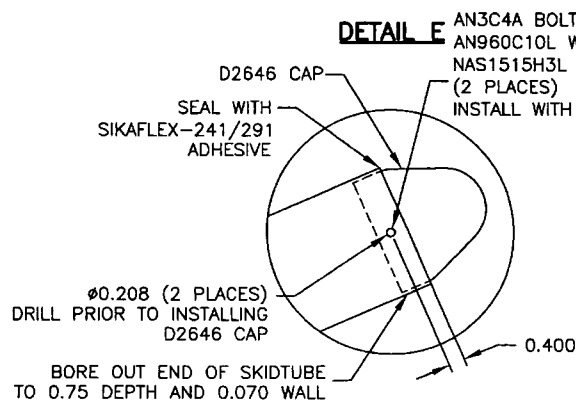

- AN3C4A BOLT (1)
AN960C10L WASHER (1)
NAS1515H3L WASHER (1)
(2 PLACES)
INSTALL WITH SIKAFLEX-241/-291

DETAIL F: END FINISHING DETAIL

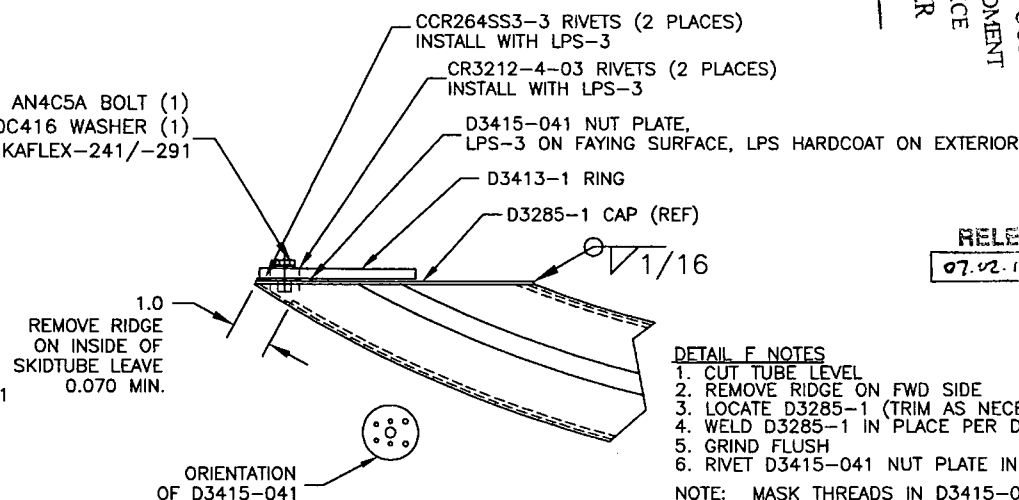

- AN4C5A BOLT (1)
AN960C416 WASHER (1)
INSTALL WITH SIKAFLEX-241/-291

- CCR264SS3-3 RIVETS (2 PLACES)
INSTALL WITH LPS-3
CR3212-4-03 RIVETS (2 PLACES)
INSTALL WITH LPS-3
D3415-041 NUT PLATE,
LPS-3 ON FAYING SURFACE, LPS HARDCOAT ON EXTERIOR
D3413-1 RING
D3285-1 CAP (REF)

DETAIL F NOTES

1. CUT TUBE LEVEL
 2. REMOVE RIDGE ON FWD SIDE
 3. LOCATE D3285-1 (TRIM AS NECESSARY)
 4. WELD D3285-1 IN PLACE PER DART QSI 004
 5. GRIND FLUSH
 6. RIVET D3415-041 NUT PLATE IN PLACE
- NOTE: MASK THREADS IN D3415-041
PRIOR TO FINISH

RELEASED
07.02.12

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.

DESIGN	CP	DRAWN BY	PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA
CHECKED	H	APPROVED	H	DRAWING NO. D3274
DATE	06.12.19	TITLE	SKIDTUBE ASSEMBLY	REV. D SHEET 4 OF 4 SCALE 1:3